2021 Chevrolet Silverado 1500 - 2WD | Cheyenne, Silverado 1500 Service Manual 14306022 | **Document ID: 5815498**

#PIP5776C: Misfire Due To Collapsed Lifter - (Apr 23, 2021)

Subject: Misfire Due To Collapsed Lifter



Brand:	Model:	Model Year:		VIN:		Facilia	
		from	to	from	to	Engine:	Transmission
Cadillac	Escalade	2021		All	All	6.2 L87	All
Chevrolet	Silverado 1500 (New Model)	2019		All	All	5.3 L84 6.2 L87	All
Chevrolet	Silverado 1500	2020-2021		All	All	5.3 L84 6.2 L87	All
Chevrolet	Suburban	2021		All	All	5.3 L84 6.2 L87	All
Chevrolet	Tahoe	2021		All	All	5.3 L84 6.2 L87	All
GMC	Sierra 1500 (New Model)	2019		All	All	5.3 L84 6.2 L87	All
GMC	Sierra 1500	2020-2021		All	All	5.3 L84 6.2 L87	All
GMC	Yukon	2021		All	All	5.3 L84 6.2 L87	All

Involved Region or Country	North America, Middle East
Condition	The vehicle may come in with a P0300 - P0308 set with a bent push rod that leads to a Collapsed lifter or a lifter that come apart.
Cause	Internal lifter concern.

© 2021 General Motors. All rights reserved.

Correction

If SI leads to a collapsed lifter and/or lifter that has come apart including a bent pushrod it is recommended to replace all lifters and lifter guides on the effected bank. At this time it is not necessary to replace the lifter on the opposite bank.

When replacing the lifter and guide please indicated which lifter has failed by marking it's location on the guide for inspection (please do not cover the date code). The parts will be requested back.

Also it is not necessary to replace the oil control solenoid.

Warranty Information

For this repair use the published labor time as called out in SI Labor Time Guide.

Version	4
Modified	01/20/2021 - Created on. 02/23/2021 - Added the Middle East 03/04/2021 - Updated to clarify models. 04/23/2021 - Update to change the correction statement

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

