
# 2008 Chevrolet EQUINOX

Submodel: SPORT | Engine Type: V6 | Liters: 3.6

Fuel Delivery: FI | Fuel: GAS

# **Communication Interface Module Battery Replacement**



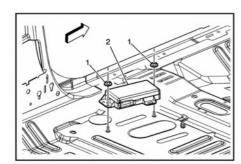

## Click to Enlarge

Callout Component Name

### Caution!

Refer to Fastener Notice in Cautions and Notices.

Fastener Tightening Specifications: Refer to Fastener Tightening Specifications

## **Preliminary Procedures**

- 1. Remove the driver seat. Refer to Seat Replacement Front Bucket .
- 2. Remove the left carpet retainer. Refer to Carpet Retainer Replacement Front .
- $3. \quad \text{Remove the left lower center pillar molding. Refer to Garnish Molding Replacement Center Pillar Lower} \ .$
- 4. Move the carpet back enough to gain access to the communication interface module battery.

Communication Interface Module Battery Nut (Qty: 3)

Tighten 10 N·m (89 lb in)

Communication Interface Module Battery

Tip Disconnect the electrical connector.