


2010 Chevrolet Equinox

Submodel: | **Engine Type:** | **Liters:**
Fuel Delivery: | **Fuel:**

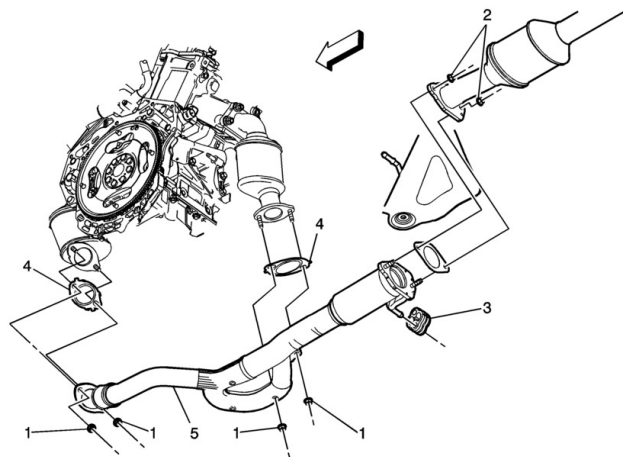

Exhaust Flexible Pipe Replacement

Callout

Component Name

Warning: Refer to Hot Exhaust System Warning.

Preliminary Procedure

1. Raise and support the vehicle. Refer to Lifting and Jacking the Vehicle
2. Remove the front lower control arm bracket brace. Refer to Front Lower Control Arm Bracket Brace Replacement
3. Disconnect the heated oxygen sensor and transfer if necessary. Refer to Heated Oxygen Sensor Replacement - Bank 2 Sensor 2

Nut (Qty: 4)

1

Caution: Refer to Fastener Caution.

Tighten

52 Y (38 lb ft).

Nut (Qty: 2)

2

Tighten

50 Y (37 lb ft).

3

Exhaust Muffler Insulator

4

Gasket

Tip: Replace with NEW gaskets.

5

Exhaust Flexible Pipe

[Top of Page](#)

[EBSCO Support Site](#) | [Privacy Policy](#) | [Terms of Use](#) | [Copyright](#)

© 2013 EBSCO Industries, Inc. All rights reserved

[EBSCO Publishing Green Initiatives](#)