


2007 Chevrolet EQUINOX

Submodel: LT | Engine Type: V6 | Liters: 3.4

Fuel Delivery: FI | Fuel: GAS

Rear Toe Adjustment

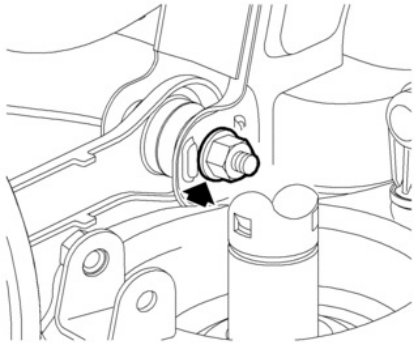

[Click to Enlarge](#)

1. Loosen the suspension adjustment link-to-frame fastener enough to allow for movement.

Important

If experiencing problems in adjusting the rear toe, replace the existing nut with the service cam nut to eliminate the adjustment problem.

2. Rotate the suspension adjustment nut in the direction necessary to correct the toe angle.
3. Snug the suspension adjustment link-to-frame fastener, do not tighten at this time.
4. Reinspect the rear toe specifications and adjust as necessary.

Caution!

Refer to Fastener Notice in the Preface section.

5. Hold the nut and tighten the link-to-frame fastener bolt.

Tighten

Tighten the bolt to 164 N-m (121 lb ft).

6. Repeat the procedure for the other rear wheel.