

Document ID: 4180938

#PIT5313C: Paint Peeling Above Anti-Chip Area - (May 8, 2015)

Subject: Paint Peeling Above Anti-Chip Area

Models: 2014 Chevrolet Silverado 1500
2015 Chevrolet Silverado 2500/3500
2014 GMC Sierra 1500
2015 GMC Sierra 2500/3500
Built at Ft. Wayne Assembly (11th VIN Position = Z)
Built Prior to 5/15/2014




This PI was superseded to update Warranty Information. Please discard PIT5313B.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some owners may comment of the paint peeling above the Anti-chip area, example shown below.

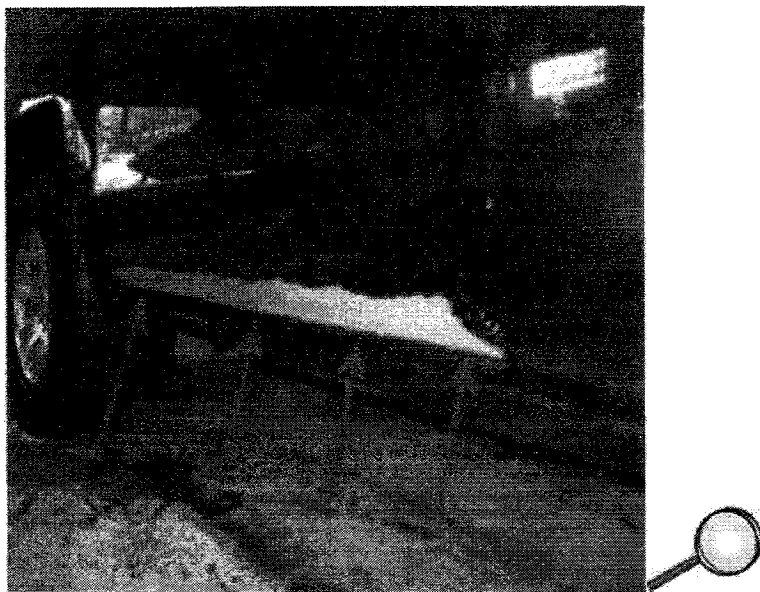

Note: Process revisions were made at the vehicle assembly plant to resolve this issue effective 5/15/2014.

Recommendation/Instructions

If a vehicle comes in for this concern, a test should be performed on the remaining panels using the following

This test should only be conducted on a vehicle exhibiting this condition and performed above the Anti-Chip area. On a clean surface, at or above room temperature, firmly apply a 2" wide piece of masking tape to the body, and pull upward quickly. Do not use duct tape, cloth backed tape, or other aggressive tapes. If the paint flakes or peels away, the panel in question should be repaired.

© 2015 General Motors. All rights reserved.