

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Bumpers and Fascias - Avalanche, Escalade, Suburban, Tahoe & Yukon

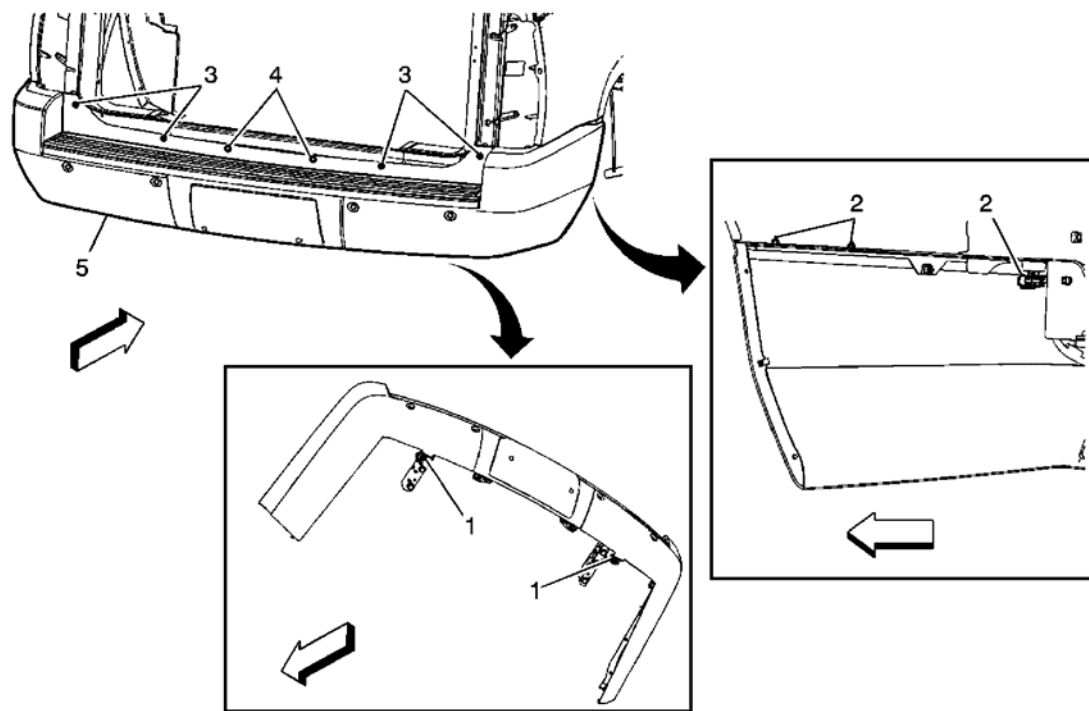


Fig. 18: View Of Rear Bumper Fascia Assembly & Components

Courtesy of GENERAL MOTORS CORP.

Rear Bumper Fascia Replacement (All Utility, Cadillac ESV)

Callout	Component Name
Preliminary Procedure: Remove the rear wheelhouse inner panel extensions. Refer to <u>Wheelhouse Liner Panel Replacement - Rear</u> .	
1	Rear Fascia Bolts (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 9 N.m (80 lb in)
2	Rear Fascia Plastic Bolts (Qty: 4) Tip: Disconnect the rear object detection sensor harness located in the right end of the fascia and any other electrical connectors before attempting removal. Tighten: 9 N.m (80 lb in)
3	Rear Fascia Bolts (Qty: 4) Tighten: 9 N.m (80 lb in)
4	Rear Fascia Plastic Retainers (Qty: 2)
	Fascia Assembly