
Rear SeatAudio Control Replacement

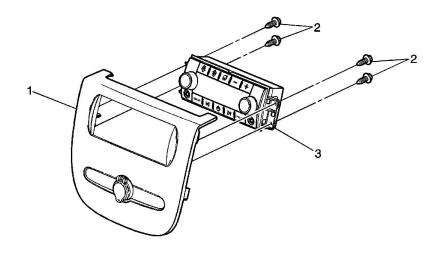

\sim	
Callout	Component Name
1	Front Floor Console Compartment Bezel Assembly
	Refer to Front Floor Console Compartment Bezel Replacement .
2	Rear Radio Control Assembly Screw (Qty: 4)
	Notice: Refer to Fastener Notice in the Preface section.
	Tip Tighten the fasteners equally to ensure the control assembly seats evenly.
	Tighten 1.5 N⋅m (13 lb in)
3	Rear Radio Control Assembly
	Procedure
	Disconnect the electrical connectors from the rear radio control assembly.

© 2013 General Motors Corporation. All rights reserved.